



Maule Aircraft Corporation

SPENCE AIR BASE

PHONE (912) 985-2045

MOULTRIE, GEORGIA 31768

PAGE 1 of 1

20 August 1974

SERVICE LETTER #30

Subject: Right Side Exhaust System Hanger Brace



Models Affected: M-4-220 Aircraft, All Serial Numbers
M-5-220 Aircraft Serial Numbers 5001C through 5024G.

Compliance: Mandatory within the next fifty (50) hours of engine operation.

Authority: This Service Letter is F.A.A. Approved.

Background: Exhausts braced to the tab on the engine header stack put too much strain on the stack.

Description: If the Right Side Exhaust System is braced to the engine stack, remove the brace and rework it to the configuration shown in Figure A below. Attach it to the alternator mount by Bracket 5192 B-2 as shown in Figure B below.

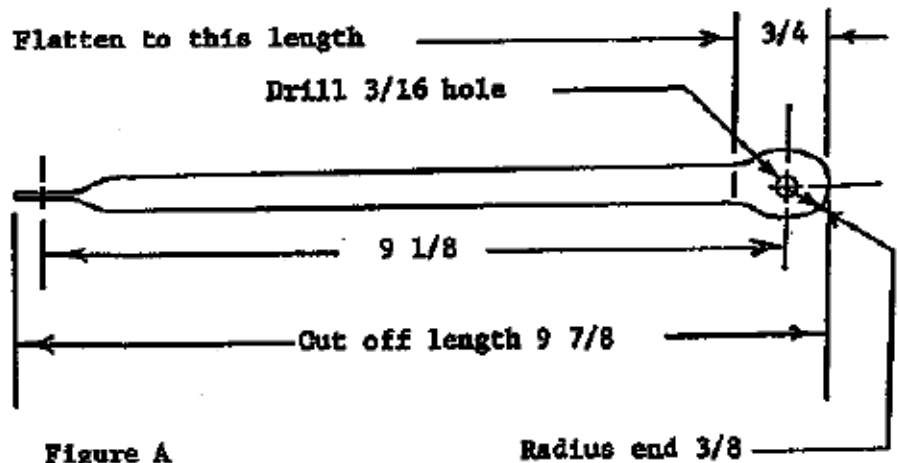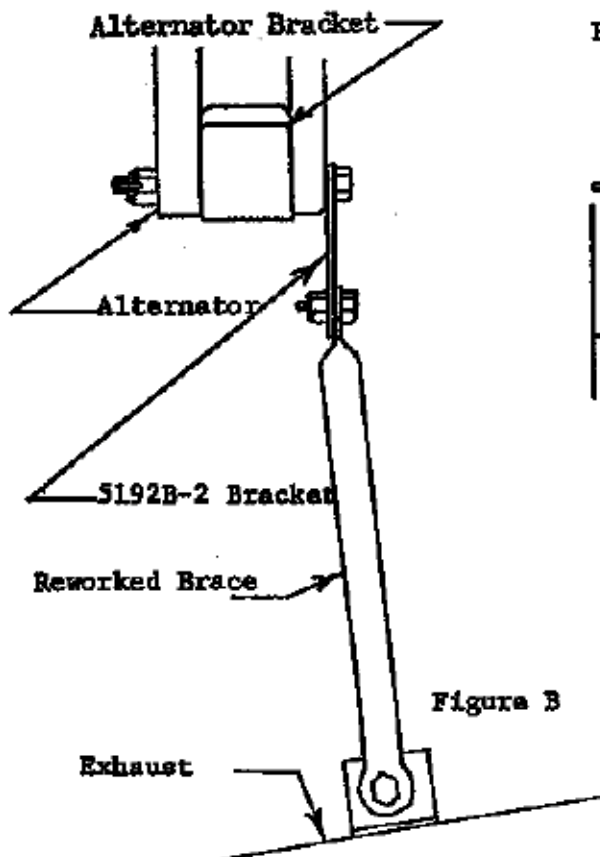



Maule Aircraft Corporation

SPENCE AIR BASE

PHONE (912) 985-2045

MOULTRIE, GEORGIA 31768
20 August 1974

Compliance Record

Be it hereby attested that following Service Letter has been complied with:
(Check appropriate box)

Aircraft Serial Number _____

Aircraft Registration (N) Number _____

Service Letter #30, Right Side Exhaust System Hanger Brace.

I no longer own this aircraft. It was sold to: _____

Address: _____

City, State, Zip _____

Certified by (Signature) _____

Certified by (Print Name) _____

Title (Owner, A & E, IA, etc.) _____

Date _____